

Wiring Diagram

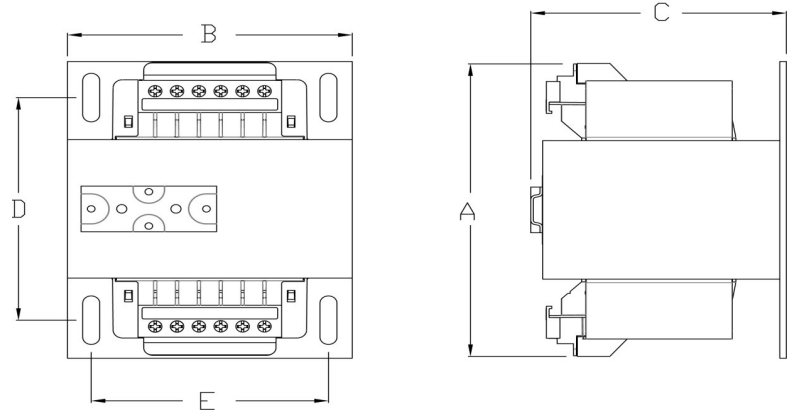


Image is a general representation of a typical MAG Control Transformer without fusing accessories or jumper links. Transformers 50VA - 350VA have 4 terminals per side, and units 500VA and higher have 6 terminals per side.

DM SERIES

PRI	SEC
220 X 440	110
230 X 460	115
240 X 480	120

Approximate Dimensions and Weight

VA Rating	MPC Part #	Max Depth (A)	Max Width (B)	Max Height (C)	Mounting Depth (D)	Mounting Depth (E)	Mounting Hole Depth	Mounting Hole Width	Shipping Weight (lbs.)
50	MPC2-1B050DMU-FO	3.32	3.00	2.79	2.00	2.50	0.20	0.41	2.60
75	MPC2-1B075DMU-FO	3.82	3.00	2.79	2.50	2.50	0.20	0.41	3.50
100	MPC2-1B100DMU-FO	3.78	3.38	3.11	2.38	2.81	0.20	0.41	4.20
150	MPC2-2B150DMU-FO	4.27	3.75	3.42	2.88	3.13	0.20	0.41	6.70
200	MPC2-2B200DMU-FO	4.05	4.50	4.04	2.50	3.75	0.20	0.41	8.50
250	MPC2-2B250DMU-FO	4.55	4.50	4.04	2.88	3.75	0.20	0.41	10.00
300	MPC2-2B300DMU-FO	4.55	4.50	4.04	3.25	3.75	0.20	0.41	11.30
350	MPC2-2B350DMU-FO	5.28	4.50	4.04	3.75	3.75	0.20	0.41	13.60
500	MPC2-2B500DMU-FO	5.75	5.25	4.66	4.25	4.38	0.31	1.06	15.75
750	MPC2-2B750DMU-FO	7.00	5.25	4.66	5.38	4.38	0.31	1.06	28.10
1,000	MPC2-1H1K0DMU-FO	6.61	7.00	5.65	4.00	6.13	0.31	1.06	29.80
1,500	MPC2-1H1K5DMU-FO	7.62	7.00	5.65	4.50	6.13	0.31	1.06	30.00
2,000	MPC2-1H2K0DMU-FO	8.37	7.00	5.43	5.13	6.13	0.31	1.06	38.00
3,000	MPC2-1H3K0DMU-**	7.82	9.00	7.62	4.25	6.50	0.44	1.00	53.00
5,000	MPC2-1H5K0DMU-**	9.06	9.00	7.62	7.25	7.50	0.44	1.00	89.00

** No Fuse Kit is available for this model

- Change end suffix for added options
- Add C to suffix for the covers

Notes:

- Jumper Link and Fuse Clip Height not included
- Add 5/16" to the Depth when fuse clips are included.(50 thru 350VA)
- Add 1/2" to the Height when fuse block is included (1, 2, and 3 poles) (500 thru 5000VA)
- Add 1 3/8" to the Height when fuse block is included (1, 2, and 3 poles) (50 thru 350VA)